


PROJECT: Proposed Tiggervalleij Extension 9	TRAIL HOLE: 76 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 33,9" S 28° 22' 48,7" E	

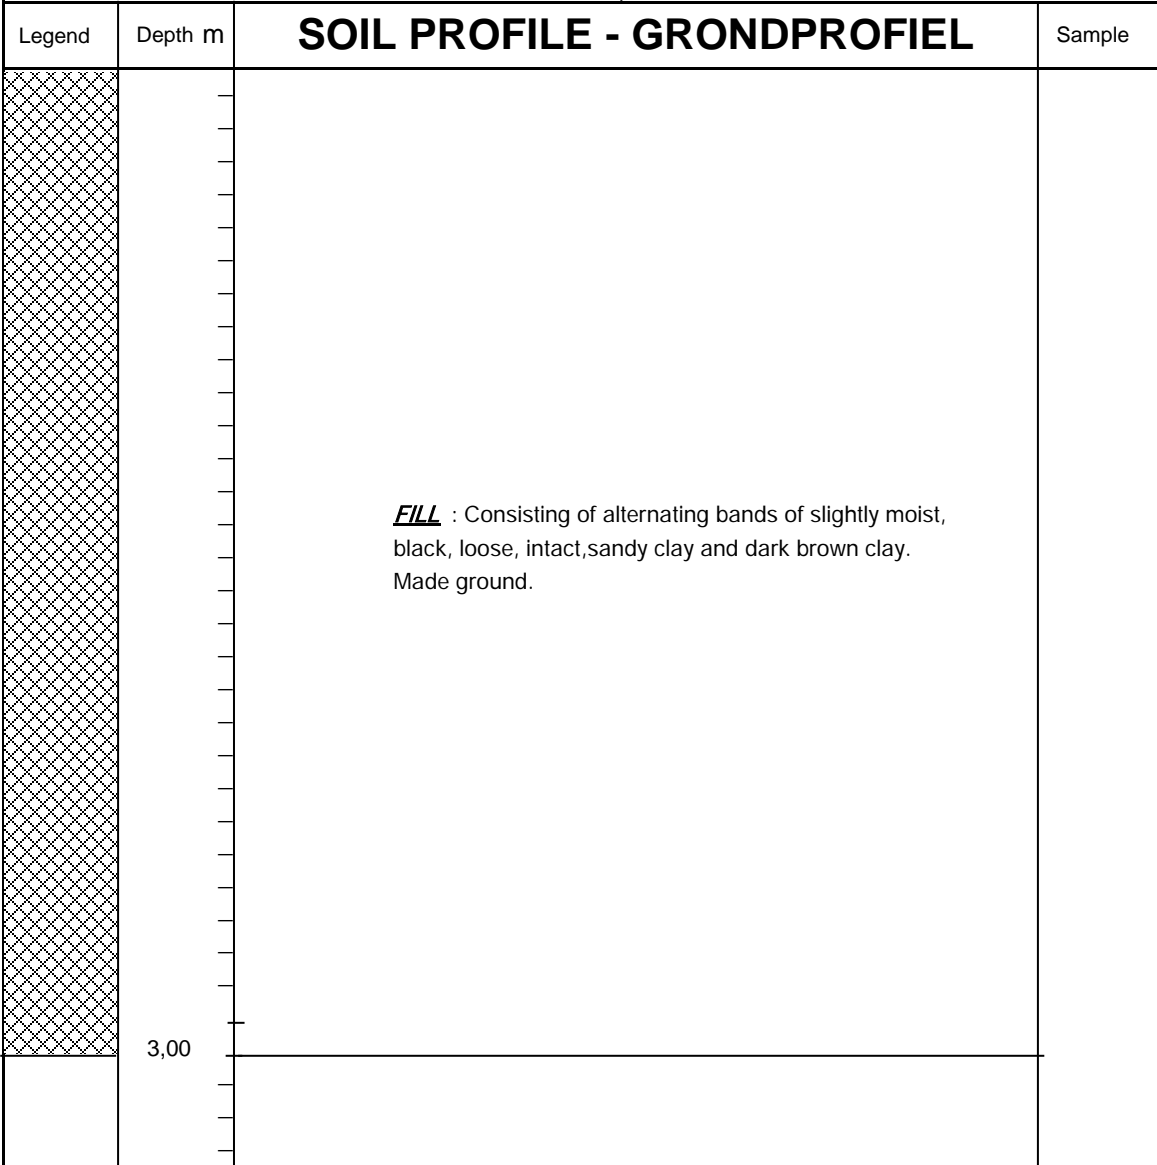


	Water encountered Water teëgekom	Contractor: SNALAB Kontrakteur:	NOTES / NOTAS 1 Refusal of excavation at 3000mm on very hard rock, shale. 2 Seepage water not encountered.
	Water level Waterrusvlak		
	Bottom of hole Bodem van gat	Date Drilled: 17 March 2006 Datum Geboor:	
	Approximate material change Benaderde materiaalverandering	Machine: John Deere 310A Masjien:	
---	Disturbed sample Versteurde monster		
	Undisturbed sample Onversteurde monster	Hole diameter: 700mm Gat deursnee:	
	Consolidation sample Konsolidasie monster		
C	Indicator tests Klassifikasie toets	Water depth: Watervlak:	
I			

SOIL	SOIL PROFILE : TEST PIT 76
-------------	-----------------------------------

FIG A76

PROJECT: Proposed Tjigervalleij Extension 10	TRAIL HOLE: 77 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 26,1" S 28° 22' 47,1" E	

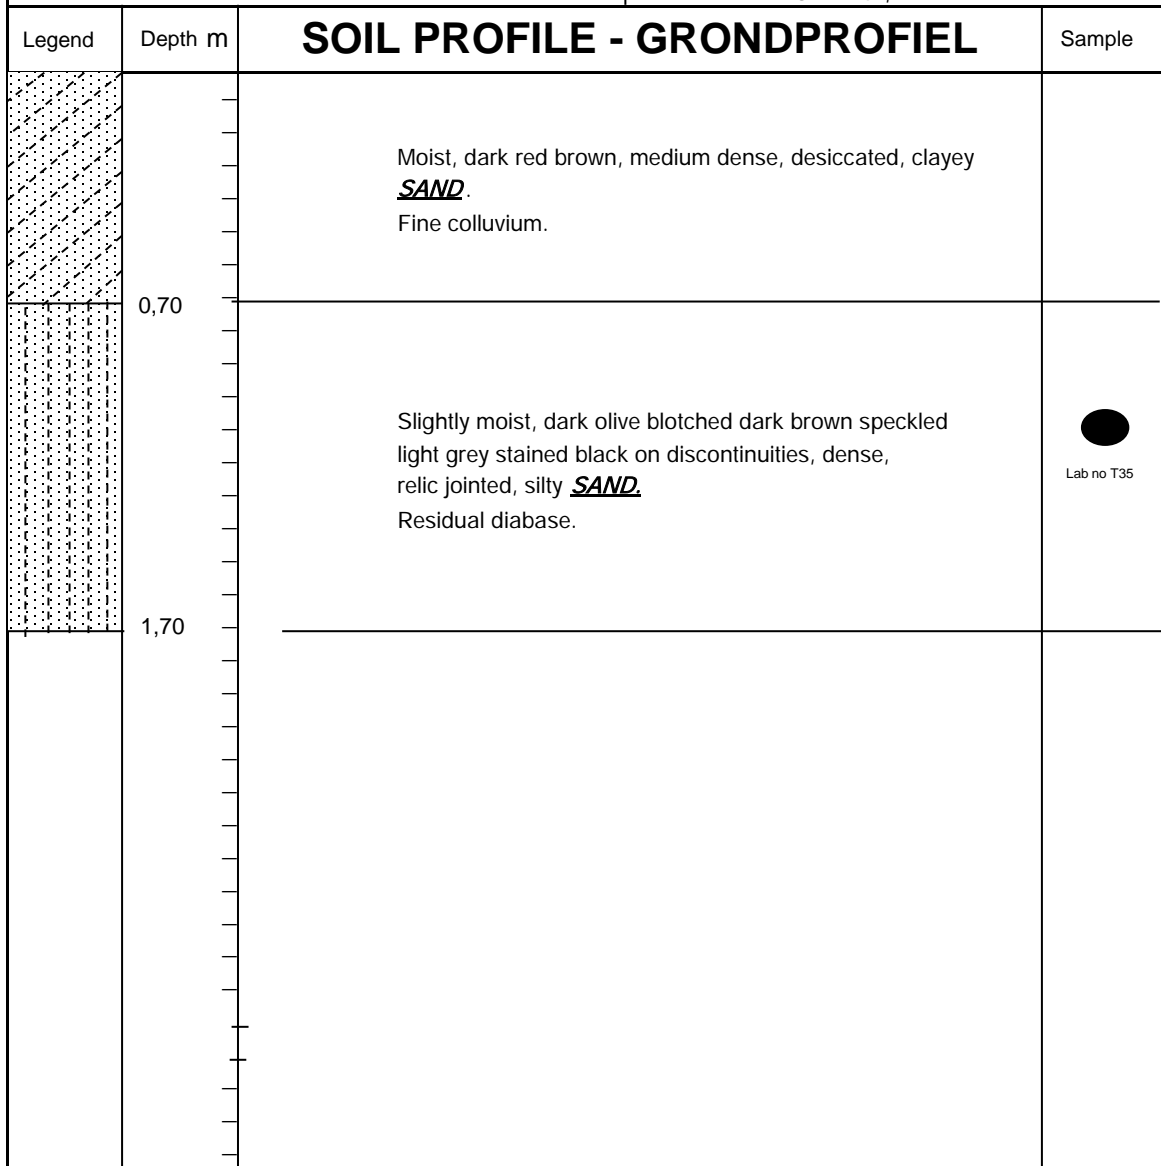


	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation encountered at 1700mm on very hard rock, diabase. 2 Seepage water not encountered.
	Water level Waterrusvlak	Kontrakteur:	
	Bottom of hole Bodem van gat	Date Drilled: 16 March 2006 Datum Geboor:	
	Approximate material change	Machine: John Deere 310A Masjien:	
	Benaderde materiaalverandering Disturbed sample	Hole diameter: 700mm Gat deursnee:	
	Versteurde monster Undisturbed sample	Water depth: Watervlak:	
	Onversteurde monster Consolidation sample Konsolidasie monster		
C	Indicator tests Klassifikasie toets		
I			

SOIL	SOIL PROFILE : TEST PIT 77
-------------	-----------------------------------

FIG A77

PROJECT: Proposed Tjigervalleij Extension 10	TRAIL HOLE: 78	SHEET No: 1
SITE: A Part of the Remainder of the Farm	TOETSGAT:	Vel Nr:
CLIENT: Sable Homes North (Pty) Ltd	LOGGED FJB	DATE: 25 May 2006
KLIENT:	LOCATION: 25° 46' 28,6" S	
	28° 22' 48,6" E	

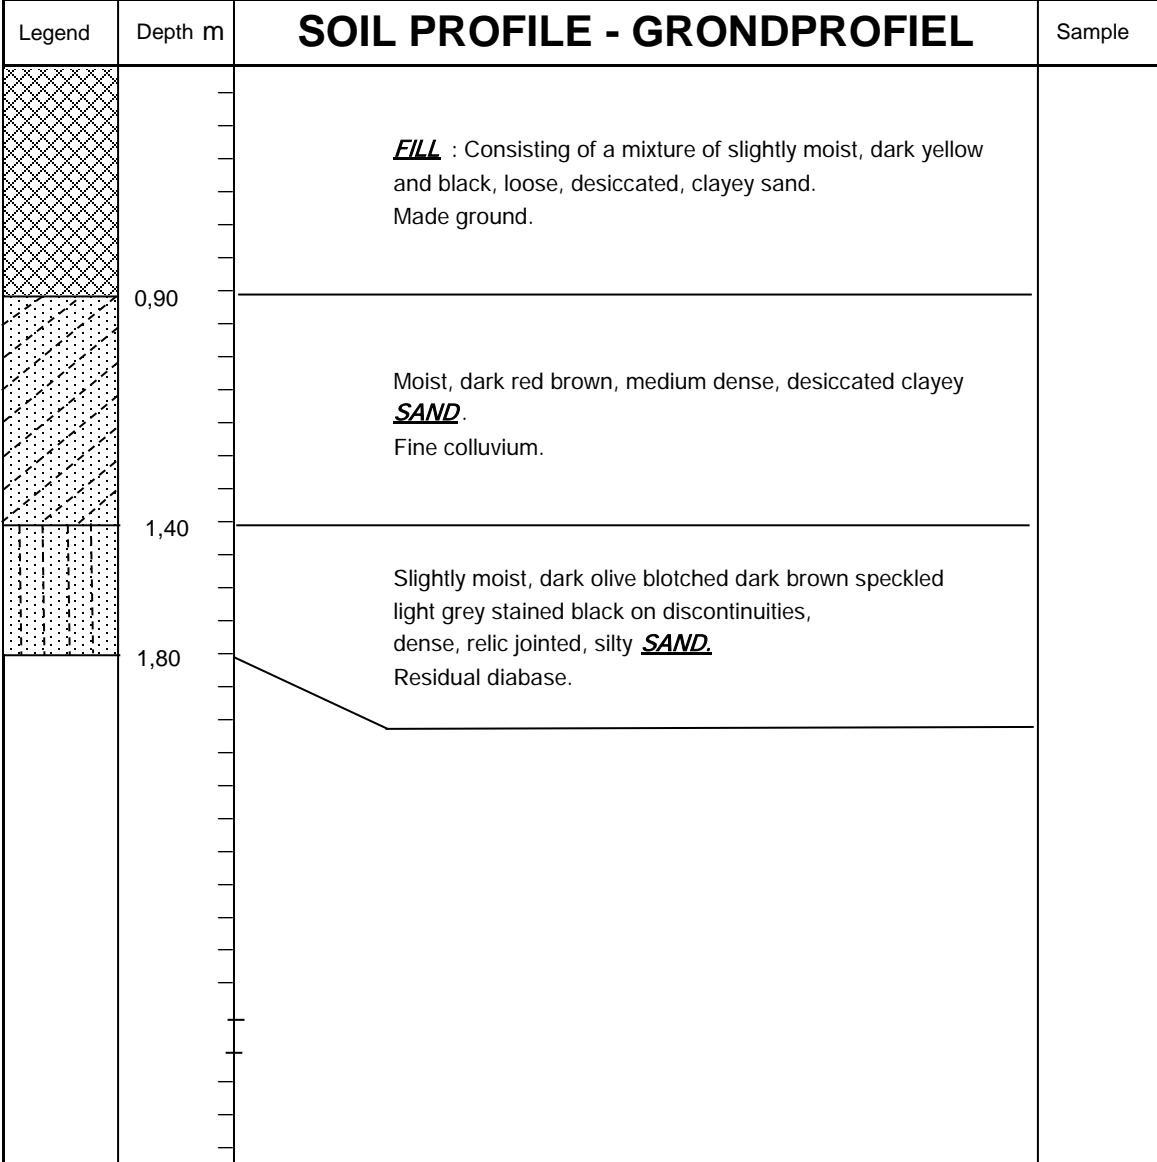


	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change	Machine: John Deere 310A	
	Benaderde materiaalverandering Disturbed sample	Masjien:	
	Versteurde monster Undisturbed sample	Hole diameter: 700mm	
	Onversteurde monster Consolidation sample Konsolidasie monster	Gat deursnee:	
C	Indicator tests Klassifikasie toets	Water depth:	
I		Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 78
-------------	-----------------------------------

FIG A78

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 79 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 28,6" S 28° 22' 48,6" E	

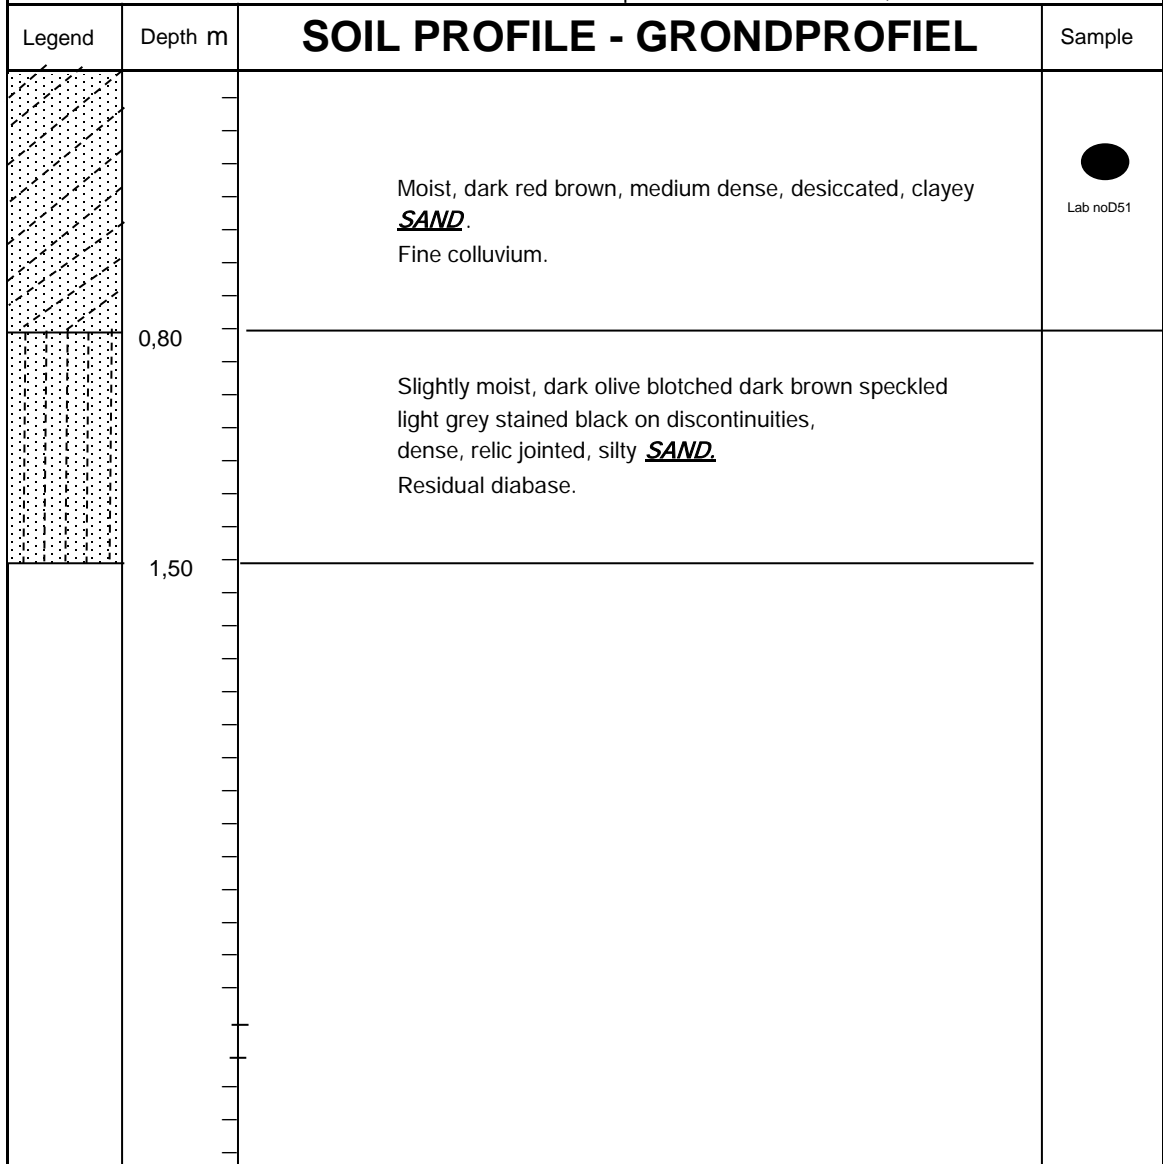








	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change	Machine: John Deere 310A	
	Benaderde materiaalverandering Disturbed sample	Masjien:	
	Versteurde monster Undisturbed sample	Hole diameter: 700mm	
	Onversteurde monster Consolidation sample Konsolidasie monster	Gat deursnee:	
C	Indicator tests Klassifikasie toets	Water depth:	
I		Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 79
-------------	-----------------------------------

FIG A79

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 80 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 24,4" S 28° 22' 51,8" E	

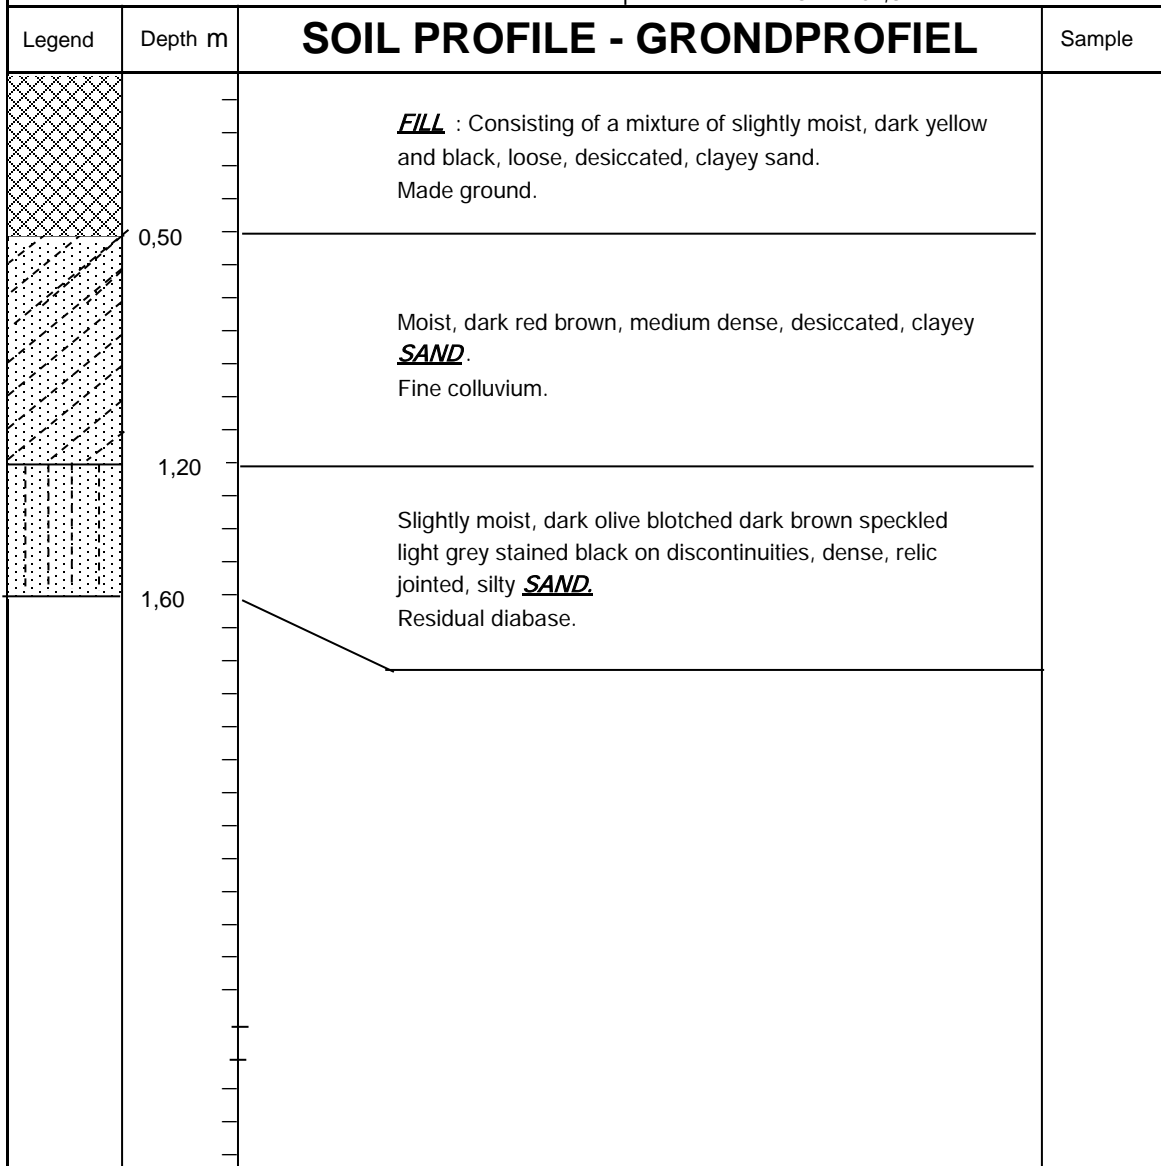


	Water encountered Water teëgekom	Contractor: SNALAB Kontrakteur:	NOTES / NOTAS 1 Refusal of excavation encountered at 1600mm on very hard rock, DIABASE. 2 Seepage water not encountered.
	Water level Waterrusvlak		
	Bottom of hole Bodem van gat	Date Drilled: 16 March 2006 Datum Geboor:	
	Approximate material change Benaderde materiaalverandering	Machine: John Deere 310A Masjien:	
	Disturbed sample Versteurde monster	Hole diameter: 700mm Gat deursnee:	
	Undisturbed sample Onversteurde monster	Indicator tests Klassifikasie toets	
C	Indicator tests Klassifikasie toets	Water depth: Watervlak:	
I			

SOIL	SOIL PROFILE : TEST PIT 80
-------------	-----------------------------------

FIG A80

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 81 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 26,6" S 28° 22' 53,7" E	

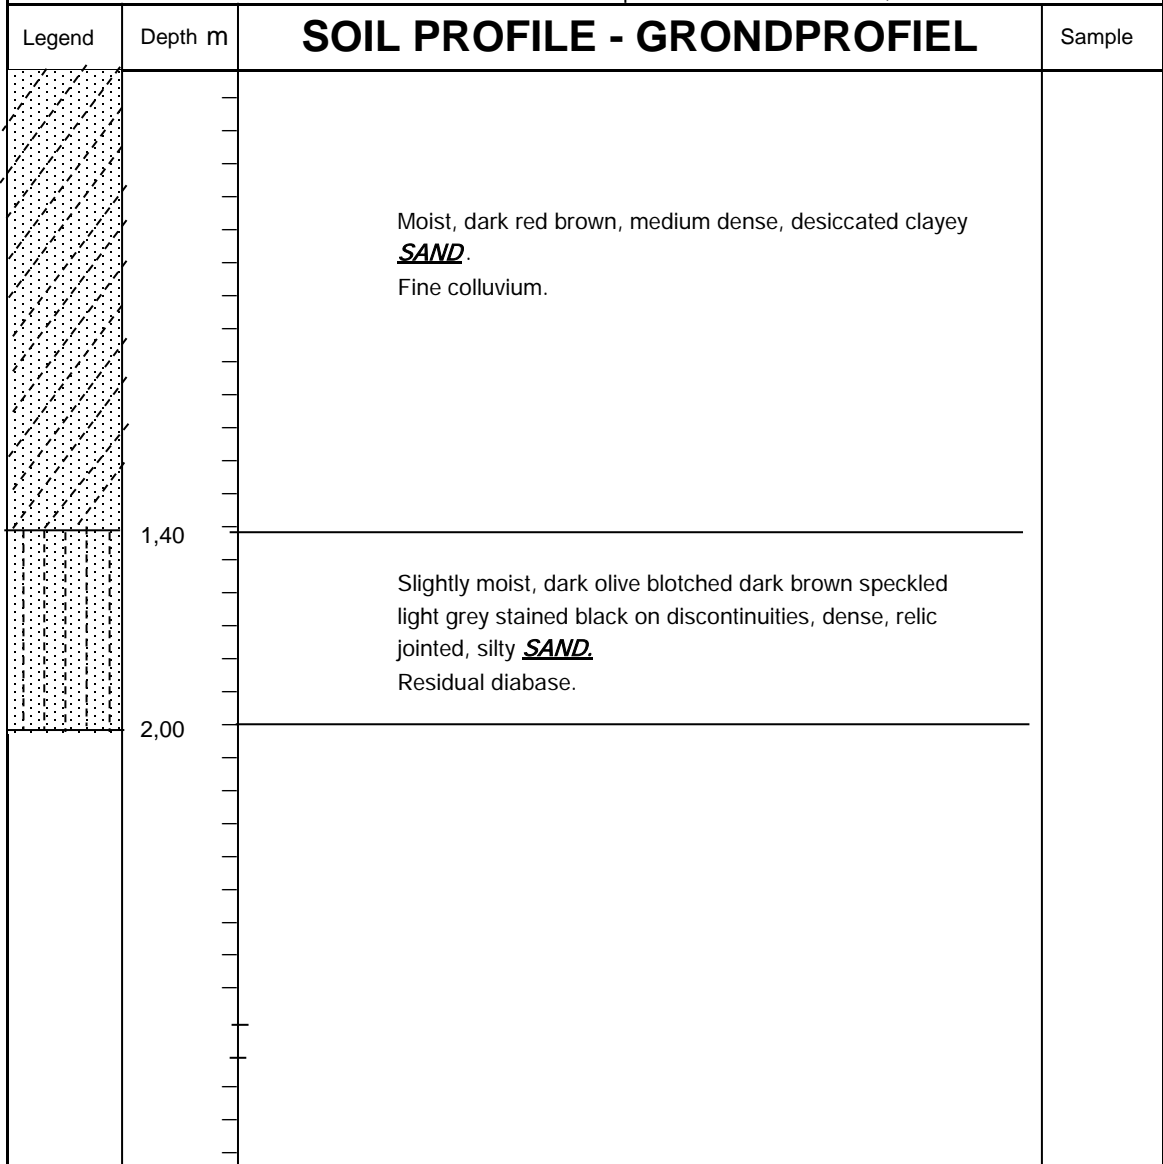










	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change	Machine: John Deere 310A	
	Benaderde materiaalverandering Disturbed sample	Masjien:	
	Versteurde monster Undisturbed sample	Hole diameter: 700mm	
	Onversteurde monster Consolidation sample Konsolidasie monster	Gat deursnee:	
C	Indicator tests Klassifikasie toets	Water depth:	
I		Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 81
-------------	-----------------------------------

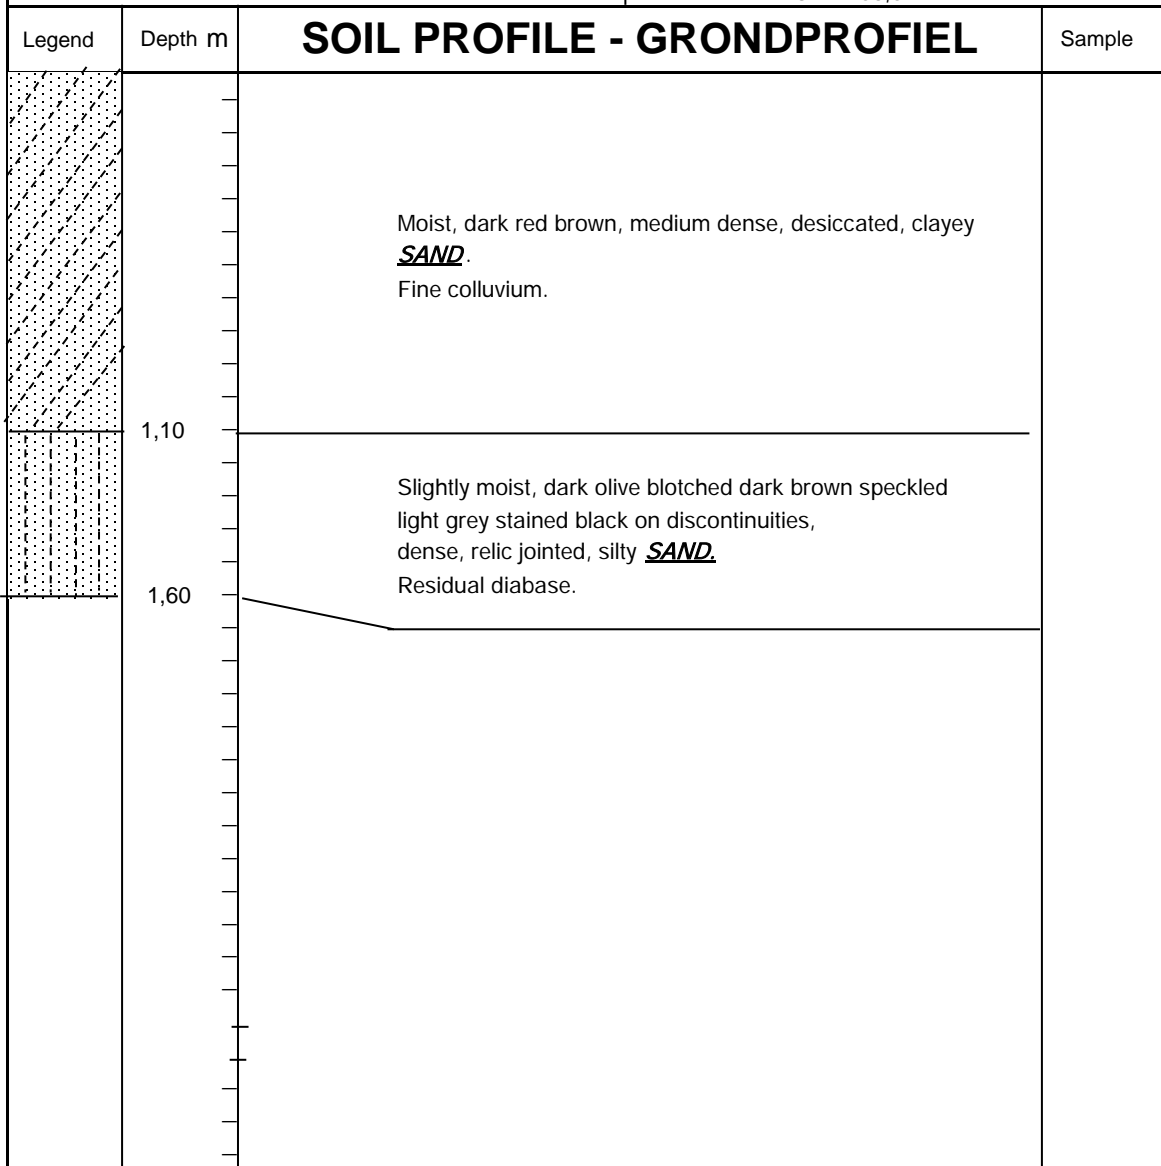FIG A81

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 82 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 22,5" S 28° 22' 53,5" E	













	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change Benaderde materiaalverandering	Machine: John Deere 310A	
	Disturbed sample Versteurde monster	Masjien:	
	Undisturbed sample Onversteurde monster	Hole diameter: 700mm	
	Consolidation sample Konsolidasie monster	Gat deursnee:	
	Indicator tests Klassifikasie toets	Water depth: Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 82
-------------	-----------------------------------

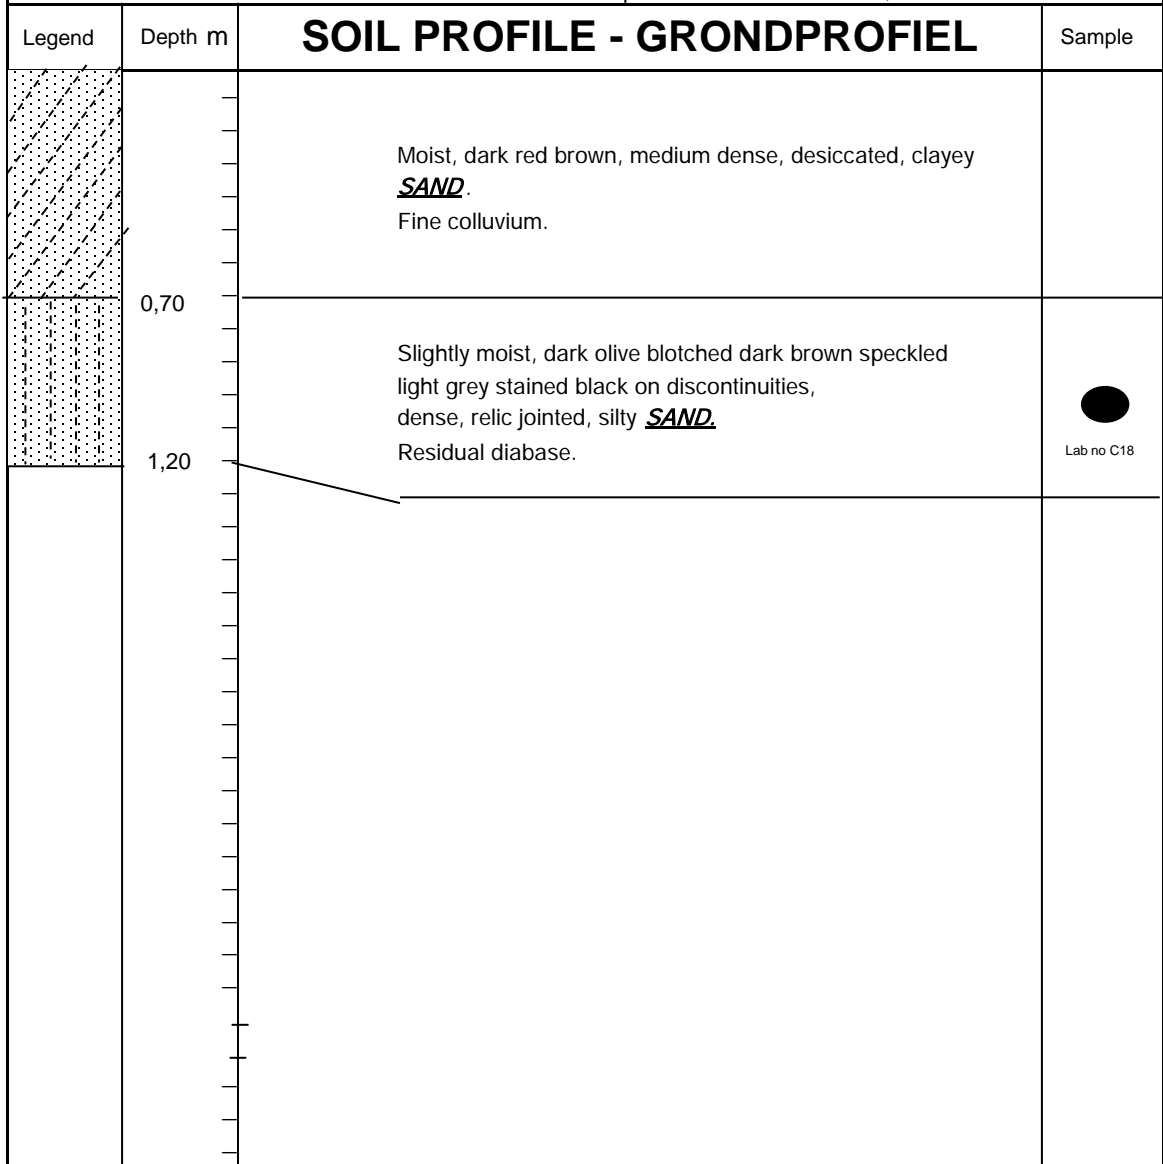FIG A82

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 83	SHEET No: 1
SITE: A Part of the Remainder of the Farm	TOETSGAT:	Vel Nr:
CLIENT: Sable Homes North (Pty) Ltd	LOGGED FJB	DATE: 25 May 2006
KLIENT:	LOCATION: 25° 46' 25,6" S	
	28° 22' 56,0" E	













	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation encountered at 1200 mm on very hard ROCK. 2 Seepage water not encountered.
	Water level Waterrusvlak	Kontrakteur:	
	Bottom of hole Bodem van gat	Date Drilled: 16 March 2006	
	Approximate material change	Datum Geboor:	
	Benaderde materiaalverandering Disturbed sample	Machine: John Deere 310A	
	Versteurde monster Undisturbed sample	Masjien:	
	Onversteurde monster Consolidation sample Konsolidasie monster	Hole diameter: 700mm	
	Indicator tests Klassifikasie toets	Gat deursnee:	
		Water depth: Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 83
-------------	-----------------------------------

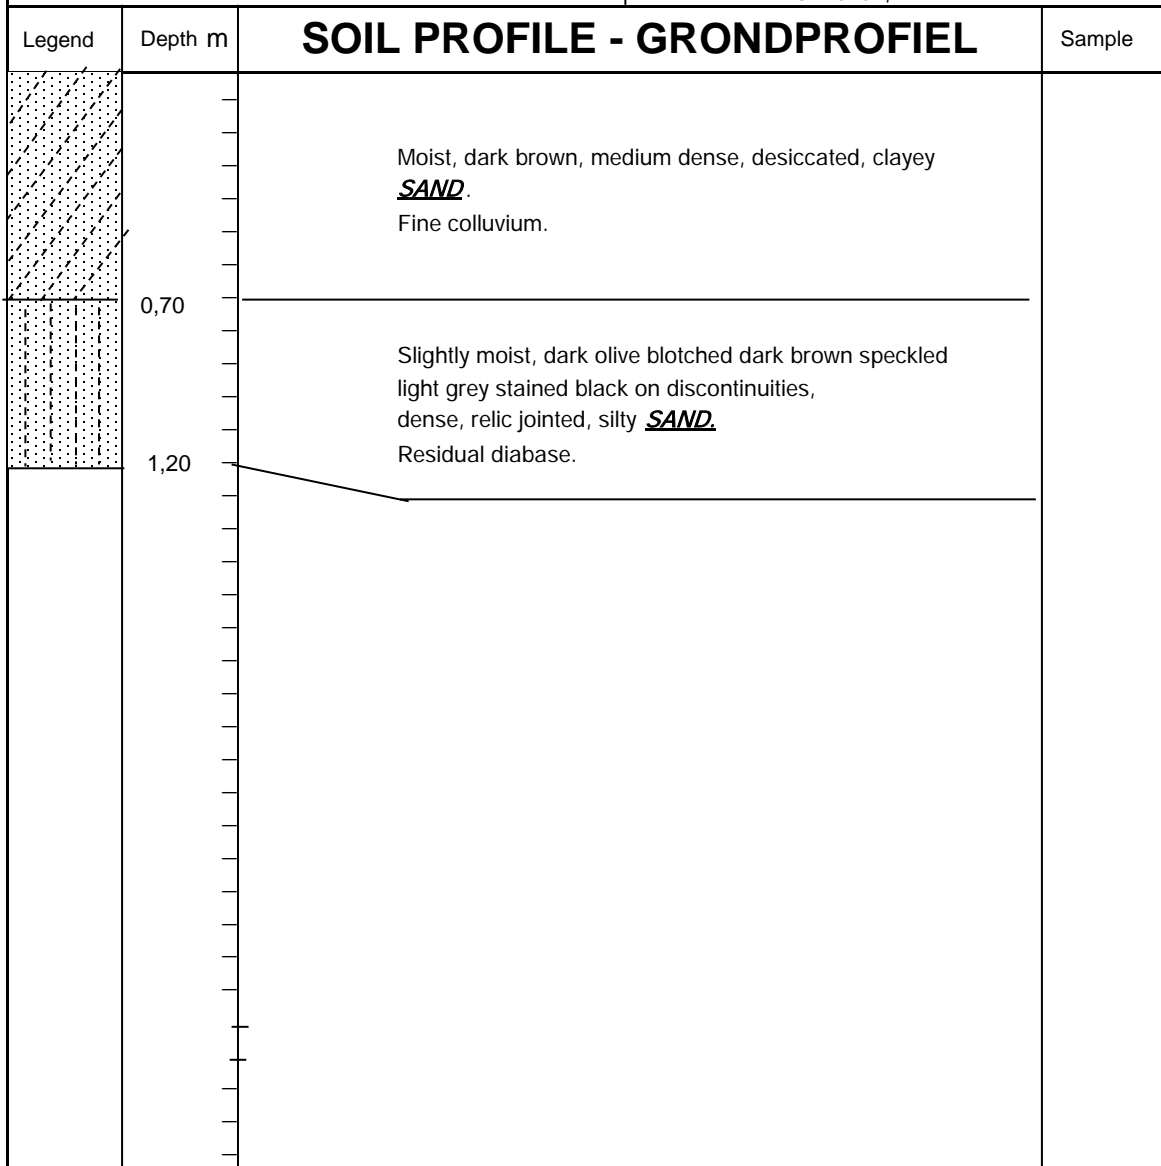FIG A83

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 84	SHEET No: 1
SITE: A Part of the Remainder of the Farm	TOETSGAT:	Vel Nr:
CLIENT: Sable Homes North (Pty) Ltd	LOGGED FJB	DATE: 25 May 2006
KLIENT:	LOCATION: 25° 46' 36,3" S	
	28° 23' 09,1" E	




	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation encountered at 1200 mm on very hard ROCK. 2 Seepage water not encountered.
	Water level Waterrusvlak	Kontrakteur:	
	Bottom of hole Bodem van gat	Date Drilled: 16 March 2006	
	Approximate material change	Datum Geboor:	
	Benaderde materiaalverandering Disturbed sample	Machine: John Deere 310A	
	Versteurde monster Undisturbed sample	Masjien:	
	Onversteurde monster Consolidation sample Konsolidasie monster	Hole diameter: 700mm	
	Indicator tests Klassifikasie toets	Gat deursnee:	
		Water depth: Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 84
-------------	-----------------------------------

FIG A84

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 85 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 36,3" S 28° 23' 06,5" E	

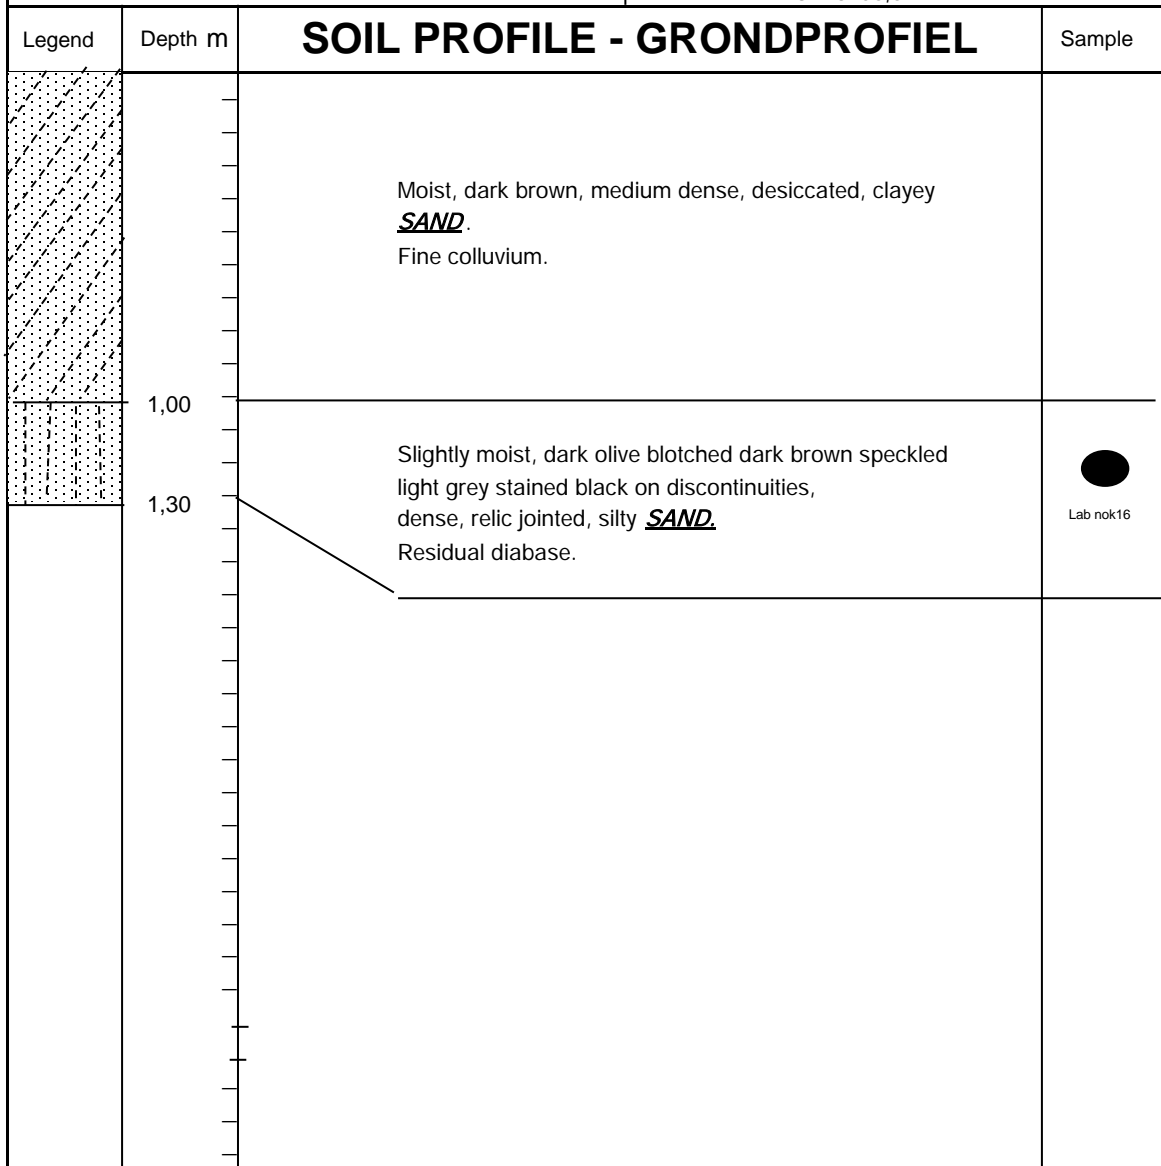


	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change	Machine: John Deere 310A	
	Benaderde materiaalverandering Disturbed sample	Masjien:	
	Versteurde monster Undisturbed sample	Hole diameter: 700mm	
	Onversteurde monster Consolidation sample Konsolidasie monster	Gat deursnee:	
C	Indicator tests Klassifikasie toets	Water depth:	
I		Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 85
-------------	-----------------------------------

FIG A85

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 86 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 35,5" S 28° 23' 04,7" E	

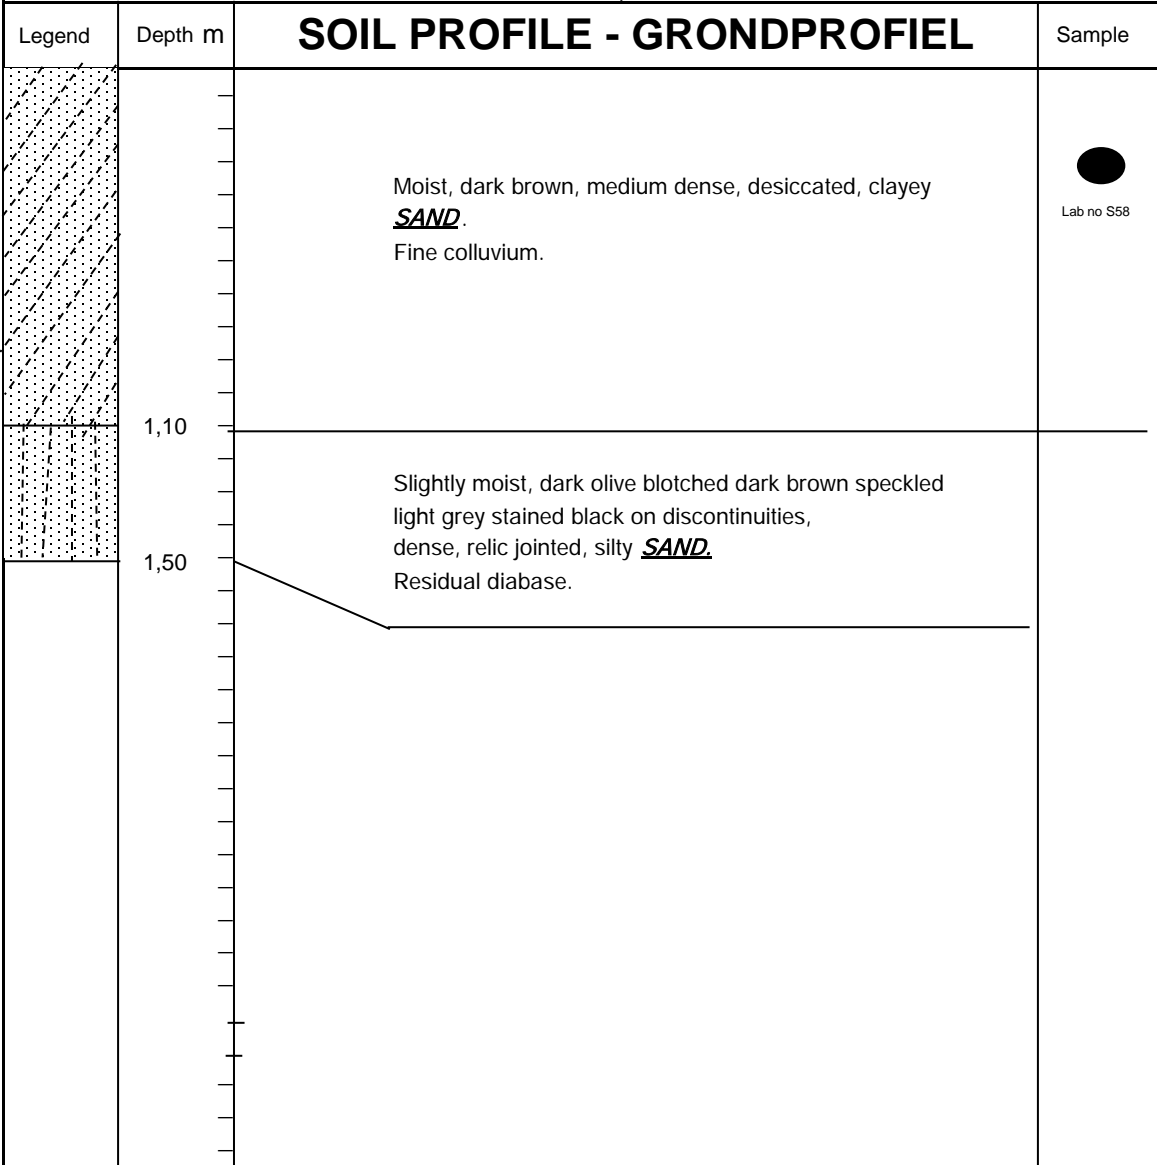


	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change	Machine: John Deere 310A	
	Benaderde materiaalverandering Disturbed sample	Masjien:	
	Versteurde monster Undisturbed sample	Hole diameter: 700mm	
	Onversteurde monster Consolidation sample Konsolidasie monster	Gat deursnee:	
C	Indicator tests Klassifikasie toets	Water depth:	
I		Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 86
-------------	-----------------------------------

FIG A86

PROJECT: Proposed Tjigervalleij Extension 10	TRAIL HOLE: 87 TOETSGAT:	SHEET No: 1 Vel Nr:
SITE: A Part of the Remainder of the Farm	LOGGED FJB	DATE: 25 May 2006
CLIENT: Sable Homes North (Pty) Ltd KLIENT:	LOCATION: 25° 46' 27,5" S 28° 23' 09,3" E	

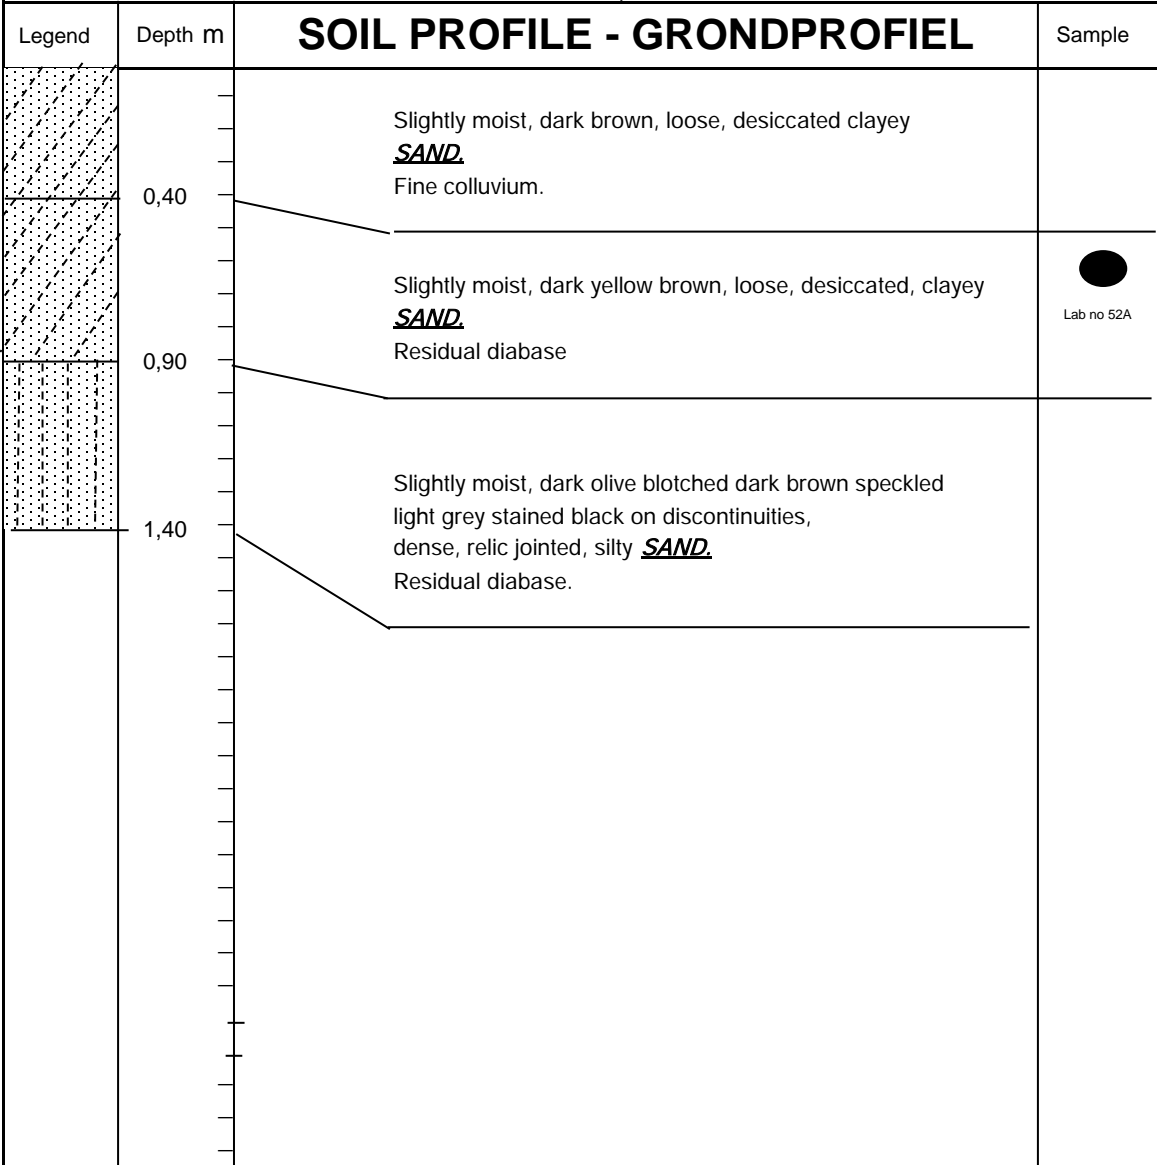


	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change	Machine: John Deere 310A	
	Benaderde materiaalverandering Disturbed sample	Masjien:	
	Versteurde monster Undisturbed sample	Hole diameter: 700mm	
	Onversteurde monster Consolidation sample Konsolidasie monster	Gat deursnee:	
C	Indicator tests Klassifikasie toets	Water depth:	
I		Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 87
-------------	-----------------------------------

FIG A87

PROJECT: Proposed Tiggervalleij Extension 10	TRAIL HOLE: 88	SHEET No: 1
SITE: A Part of the Remainder of the Farm	TOETSGAT:	Vel Nr:
CLIENT: Sable Homes North (Pty) Ltd	LOGGED FJB	DATE: 25 May 2006
KLIENT:	LOCATION: 25° 46' 26,1" S	
	28° 23' 13,4" E	

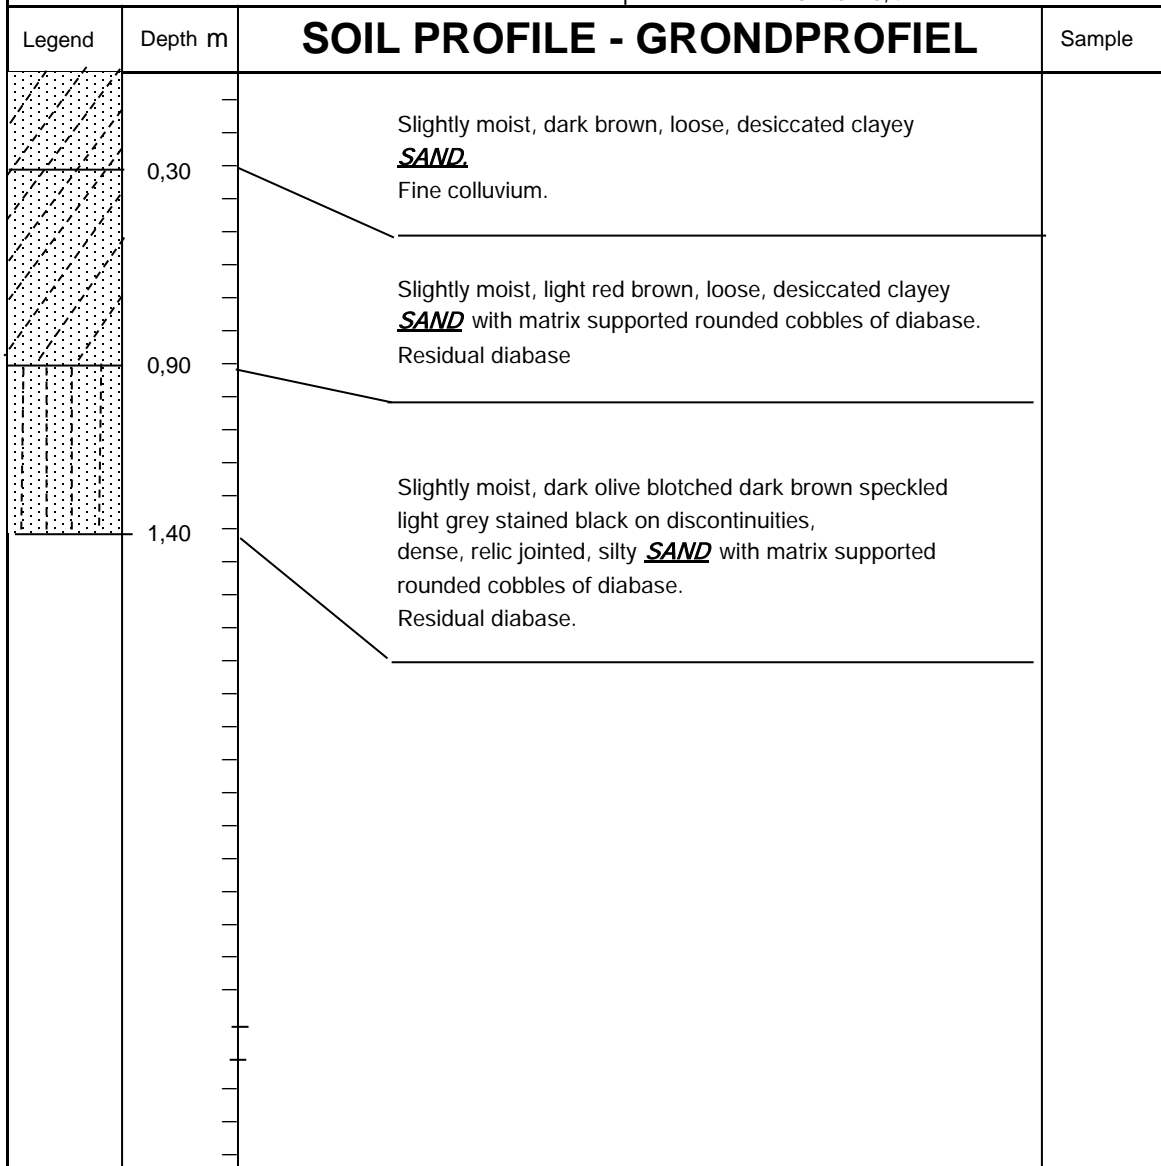

	Water encountered Water teëgekom	Contractor: SNALAB	NOTES / NOTAS 1 Refusal of excavation not encountered. 2 Seepage water not encountered.
	Water level Waterrusvlak	Date Drilled: 16 March 2006	
	Bottom of hole Bodem van gat	Datum Geboor:	
	Approximate material change Benaderde materiaalverandering	Machine: John Deere 310A	
	Disturbed sample Versteurde monster	Masjien:	
	Undisturbed sample Onversteurde monster	Hole diameter: 700mm	
	Consolidation sample Konsolidasie monster	Gat deursnee:	
C	Indicator tests Klassifikasie toets	Water depth:	
I		Watervlak:	

SOIL	SOIL PROFILE : TEST PIT 88
-------------	-----------------------------------

FIG A88
